OREGON CORNER RESTORATION FORM

COUNTY: Umatilla DATE: 02/21/06

CORNER DESIGNATION: 3N31, X-1, The West One-Quarter Corner of Section 31.

PREVIOUS RENEWALS/SURVEYS ETC.: Corner established by David P. Thompson, under Contract No. 81, dated July 8, 1859. Record states: Set post for 1/4 Sec. corner and build mound of earth with pits, trench &c., as per instructions.

MONUMENT AND ACCESSORIES FOUND: None.

MONUMENT MARKING DETAIL: T3N R30E <u>1</u> R31E 4 S36|S31 2006 PLS 1106

MONUMENT SET:

Re-established corner by single proportionate measure between the reestablished Southwest and Northwest corners of Section 31. At reestablished corner position, set a 2 3/8" brass cap on 1 1/4" x 30" galvanized iron pipe with cap flush with ground.

From which:

A 5/8" x 24" rebar with 1 1/4" yellow plastic cap marked "OR PLS 1106 WA PLS 17372" bears North 4 1/2° East, 61.2 feet.

A 5/8" x 24" rebar with 1 1/4" yellow plastic cap marked "OR PLS 1106 WA PLS 17372" bears South 02° East, 42.7 feet.

A 5/8" x 24" rebar with 1 1/4" yellow plastic cap marked "OR PLS 1106 WA PLS 17372" bears South 57 1/2° West, 45.0 feet.

A 5/8" x 24" rebar with 1 1/4" yellow plastic cap marked "OR PLS 1106 WA PLS 17372" bears North 52 1/2° West, 44.3 feet.

Attached bearing object signs to all rebar accessories. Set steel fence post with witness sign 2 feet South of monument.

LOCATION AND COMMENTS: Corner falls in the ditch on the East side of Yoakum Road.

OREGON STATE PLANE COORDINATE, North Zone, NAD 83(91), International Feet: N = 743969.60 E = 8586383.64

FIRM: William R. Wells, PLS P.O. Box 1696 Pendleton, OR 97801

COMPASS DECLINATION: 18° East

Witnesses: Jason Wells, LSIT

/3N31X1

Surveyor's Seal



N/2-4/22-C