

OREGON CORNER RESTORATION FORM

Section: 7, 8 Township: 3N Range: 33E
County: Umatilla Date: 5/24/2011

Corner Designation: 3N33G05

Quarter corner common to Sections 7, 8, T3NR33E.

_____	Condition Report Only
X	Not Found
X	Remonumented
_____	Unrecorded
X	Surveyed In
X	Referenced Out


Previous Renewals / Surveys, etc.

Originally surveyed by Chaplin in 1864. He set a post in a mound of earth.


Monuments and Accessories Found: (Condition and Source):

None.

Diagram

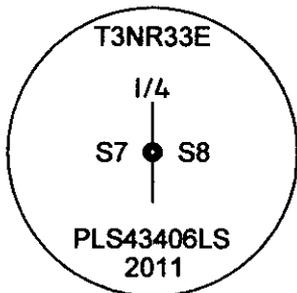

Sketch

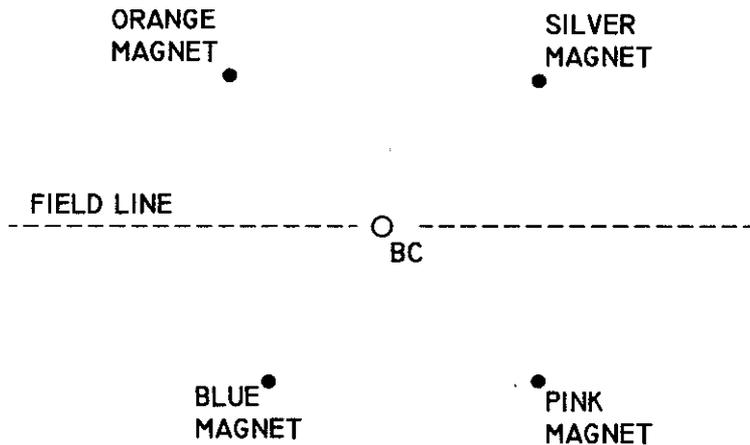

NAD 83/91
OREGON STATE PLANE NORTH
INTERNATIONAL FEET

N766056.71
E8655106.47

Monument(s) Set (Procedures and Description):

A 1 1/8" x 30" galvanized iron pipe with a 2 1/2" brass cap, stamped as shown above, 1.2' below the surface. Location of corner was reestablished by holding the North-South line between found corners and by holding a long established East-West plow berm which fell 6', more or less, South of the single proportioned Northing.

References Set:

- "Deep One" magnets by Berntsen.
- An orange magnet lies N 44° 45' W, 22.43', 1.3' deep.
- A silver magnet lies N 47° E, 21.90', 1.4' deep.
- A pink magnet lies S 45° E, 22.77', 1.2' deep.
- A blue magnet lies S 36° 30' W, 19.15', 1.1' deep

Location and Comments:

The corner is located 1/2 mile South and 1/2 mile West of the intersection of Anderson Rd. and Myrick Rd.

Compass Declination

17° E

Surveyors Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. English

OREGON
JANUARY 11, 2005
ROBERT DOUGLAS ENGLISH
43406LS

RENEWAL DATE: 12/31/13

RECEIVED BY:

Firm / Agency

Date: 7/10/2012
Rec'd By: S. Pass
No. 12-094-C

Survey One, LLC.
P.O. Box 382
Pendleton, OR 97801
(541) 276-2055