OREGON CORNER RESTORATION FORM

SECTION 7 TOWNSHIP 4 N RANGE 28 E J-3

COUNTY: UMATILLA

DATE 12/95

CORNER DESIGNATION

CONDITION REPORT ONLY NOT FOUND

RENEWED

S 1/4 COR

UNRECORDED X_SURVEYED IN X_REFERENCED OUT


PREVIOUS RENEWALS/SURVEYS, ETC.

Originally surveyed by Haft in 1860 I found a 1 " iron bar in a 1978 survey for Jim Kooch I set BC incorrectly in 1994

MONUMENTS & ACCESSORIES FOUND: Condition and Source Fnd a round headed bolt S 88° 44' 21" E 2.92 feet from corner. Orig. unknown. Fnd a 1/2" rebar N 44° 26' 26" E 28.28 feet from cor. set by me in 1978 sur. for Kooch. Fnd. my 1994 2 3/8" BC S 50° 50' 31" E 1.04 feet from the cor.

MONUMENT DETAIL

SKETCH

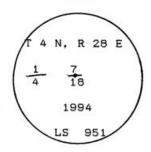

MONUMENT SET (PROCEDURES AND DESCRIPTION)

By retracing my 1978 Kooch survey I reset the 1"X30" Iron Pipe with a 2 3/8" Brass cap stamped as above at the paved surface.

NEW ACCESSORIES From which An alum. tag #951 in a 20" locust bears N 40° 46' 21" W 33.18 feet An Alum. tag #951 in a P. Pole bears N 27° 37' 26" E 45.44 ft A 1/2" rebar bears N 44° 26' 26" E 28.28 feet A round headed bolt bears S 88° 44' 21" E 2.92 feet An alum. tag # 951 in a P. Pole bears S 39° 36' E 36.24 feet

LOCATION & COMMENTS At the intersection of Bridge Rd. & Lewis Rd.

RECEIVED BY

Umatilla County Surveyor

Beo'd By.

COMPASS DEC. FIRM EDWARDS SURVEYING P.O.BOX 763, HERMISTON OREGON, 97838 PARTY CHIEF D. EDWARDS

NOTES WITNESS S. BENEFIT SURVEYOR'S SEAL

REGISTERED **PROFESSIONAL** LAND SURVEYOR

OREGON G. DENNIS EDWARDS

951 RENEWS 12/31/95